

*PUPC* MIT/IL SOFTWARE ANOMALY REPORT

*NA*

REPORT NO. **COM 3**  
 PROGRAM **COLOSSUS 2**  
 PROGRAM REVISION **COMANCHE 44**

1.1 ORIGINATOR: <b>M. Hamilton</b>	1.2 ORGANIZATION: <b>MIT</b>	1.3 DATE: <b>2/27/69</b>	1.4 ORIGINATOR CONTROL NO.
---------------------------------------	---------------------------------	-----------------------------	----------------------------

1.5 DESCRIPTION OF ANOMALY:  
 If a PROCEED response is made to V53 flashing in P53 and P54, the program hangs up as a sleeping job.

CONTINUED ON PAGE

1.6 DESCRIPTION OF RUN:  
 Hybrid run testing out P54.

CONTINUED ON PAGE

- MIT ANALYSIS -

2.1 CAUSE:  
 Coding error.

CONTINUED ON PAGE

2.2 RECOGNITION: After a PRO response to V53 flashing, the DSKY remains blank thereafter.

CONTINUED ON PAGE

2.3 MISSION EFFECT:  
 Requires recovery.

CONTINUED ON PAGE

2.4 AVOIDANCE PROCEDURE:  
 Do not PRO on V53 flashing in P53, P54.

CONTINUED ON PAGE

2.5 RECOVERY PROCEDURE:  
 Select P54 again *or P53 pages*

CONTINUED ON PAGE

2.6 PROGRAM CORRECTION:  
 Change PRO response to redisplay V53 without doing a CLEANDSP.

CONTINUED ON PAGE

2.7 RECOMMENDED DISPOSITION (Fix, Work-around, etc):  
 Fix for COLOSSUS 2A.

CONTINUED ON PAGE

2.8 RECOMMENDED RE-TESTING:

CONTINUED ON PAGE

2.9 MIT/IL SIGNATURE: *Sam H. Hamilton* 2.10 DATE: **2/27/69**

3.1 NASA DIRECTION:

CONTINUED ON PAGE

4.1 CLOSING ACTION TAKEN:  
 MIT will fix for COLOSSUS 2A.

CONTINUED ON PAGE

1.2 NASA/MSC SIGNATURE:	3.3 ORGANIZATION:	3.4 DATE:	4.2 SIGNATURE:	4.3 ORGANIZATION:	4.4 DATE:
-------------------------	-------------------	-----------	----------------	-------------------	-----------