

Inspector, who may add comments and then send it to the Manager, Wichita ACO.

Note 2: Information concerning the existence of approved alternative methods of compliance with this AD, if any, may be obtained from the Wichita ACO.

Special Flight Permits

(c) Special flight permits may be issued in accordance with sections 21.197 and 21.199 of the Federal Aviation Regulations (14 CFR 21.197 and 21.199) to operate the airplane to a location where the requirements of this AD can be accomplished.

Incorporation by Reference

(d) The actions shall be done in accordance with Raytheon Service Bulletin SB 76-3480, dated August 2001, excluding Service Bulletin/Kit Drawing Report Fax. This incorporation by reference was approved by the Director of the Federal Register in accordance with 5 U.S.C. 552(a) and 1 CFR part 51. Copies may be obtained from Raytheon Aircraft Company, Department 62, PO Box 85, Wichita, Kansas 67201-0085. Copies may be inspected at the FAA, Transport Airplane Directorate, 1601 Lind Avenue, SW., Renton, Washington; at the FAA, Wichita Aircraft Certification Office, 1801 Airport Road, Room 100, Mid-Continent Airport, Wichita, Kansas; or at the Office of the Federal Register, 800 North Capitol Street, NW., suite 700, Washington, DC.

Effective Date

(e) This amendment becomes effective on February 18, 2003.

Issued in Renton, Washington, on December 30, 2002.

Kevin Mullin,

Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.

[FR Doc. 03-150 Filed 1-10-03; 8:45 am]

BILLING CODE 4910-13-P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. 2002-NM-56-AD; Amendment 39-13002; AD 2002-26-14]

RIN 2120-AA64

Airworthiness Directives; Boeing Model 767-300 Series Airplanes Modified by Supplemental Type Certificate ST01869AT-D

AGENCY: Federal Aviation Administration, DOT.

ACTION: Final rule; request for comments.

SUMMARY: This amendment adopts a new airworthiness directive (AD) that is applicable to all Boeing Model 767-300 series airplanes modified by supplemental type certificate ST01869AT-D. This action requires

modifying the passenger entertainment system (PES) and revising the airplane flight manual. This action is necessary to ensure that the airplane crew is able to remove electrical power from the PES when necessary and is advised of appropriate procedures for such action. Inability to remove power from the PES during a non-normal or emergency situation could result in inability to control smoke or fumes in the airplane flight deck or cabin. This action is intended to address the identified unsafe condition.

DATES: Effective January 28, 2003.

The incorporation by reference of certain publications listed in the regulations is approved by the Director of the Federal Register as of January 28, 2003.

Comments for inclusion in the Rules Docket must be received on or before March 14, 2003.

ADDRESSES: Submit comments in triplicate to the Federal Aviation Administration (FAA), Transport Airplane Directorate, ANM-114, Attention: Rules Docket No. 2002-NM-56-AD, 1601 Lind Avenue, SW., Renton, Washington 98055-4056. Comments may be inspected at this location between 9 a.m. and 3 p.m., Monday through Friday, except Federal holidays. Comments may be submitted via fax to (425) 227-1232. Comments may also be sent via the Internet using the following address: 9-anm-iarcomment@faa.gov. Comments sent via fax or the Internet must contain "Docket No. 2002-NM-56-AD" in the subject line and need not be submitted in triplicate. Comments sent via the Internet as attached electronic files must be formatted in Microsoft Word 97 for Windows or ASCII text.

The service information referenced in this AD may be obtained from TIMCO Engineered Systems, Inc., 623 Radar Road, Greensboro, North Carolina 27410. This information may be examined at the FAA, Transport Airplane Directorate, 1601 Lind Avenue, SW., Renton, Washington; or at the FAA, Atlanta Aircraft Certification Office, One Crown Center, 1895 Phoenix Boulevard, suite 450, Atlanta, Georgia; or at the Office of the Federal Register, 800 North Capitol Street, NW., suite 700, Washington, DC.

FOR FURTHER INFORMATION CONTACT: Robert Chupka, Aerospace Engineer, Systems and Flight Test Branch, ACE-116A, FAA, Atlanta Aircraft Certification Office, One Crown Center, 1895 Phoenix Boulevard, suite 450, Atlanta, Georgia 30349; telephone (770) 703-6070; fax (770) 703-6097.

SUPPLEMENTARY INFORMATION:

Discussion

The Federal Aviation Administration (FAA) recently completed a review of in-flight entertainment (IFE) systems certified by supplemental type certificate (STC) and installed on transport category airplanes. The review focused on the interface between the IFE system and airplane electrical system, with the objective of determining if any unsafe conditions exist with regard to the interface. STCs issued between 1992 and 2000 were considered for the review.

The type of IFE systems considered for review were those that contain video monitors (cathode ray tubes or liquid crystal displays; either hanging above the aisle or mounted on individual seat backs or seat trays), or complex circuitry (*i.e.*, power supplies, electronic distribution boxes, extensive wire routing, relatively high power consumption, multiple layers of circuit protection, etc.). In addition, in-seat power supply systems that provide power to more than 20 percent of the total passenger seats were also considered for the review. The types of IFE systems not considered for review include systems that provide only audio signals to each passenger seat, ordinary in-flight telephone systems (*e.g.*, one telephone handset per group of seats or bulkhead-mounted telephones), systems that only have a video monitor on the forward bulkhead(s) (or a projection system) to provide passengers with basic airplane and flight information, and in-seat power supply systems that provide power to less than 20 percent of the total passenger seats.

Items considered during the review include the following:

- Can the electrical bus(es) supplying power to the IFE system be deenergized when necessary without removing power from systems that may be required for continued safe flight and landing?

- Can IFE system power be removed when required without pulling IFE system circuit breakers (*i.e.*, is there a switch (dedicated to the IFE system or a combination of loads) located in the flight deck or cabin that can be used to remove IFE power?)?

- If the IFE system requires changes to flight crew procedures, has the airplane flight manual (AFM) been properly amended?

- If the IFE system requires changes to cabin crew procedures, have they been properly amended?

- Does the IFE system require periodic or special maintenance?

In all, approximately 180 IFE systems approved by STC were reviewed by the