

## PART 39—AIRWORTHINESS DIRECTIVES

1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

### § 39.13 [Amended]

2. Section 39.13 is amended by adding the following new airworthiness directive:

**Boeing:** Docket 2002–NM–54–AD.

**Applicability:** Model 767–300 series airplanes modified by Supplemental Type Certificate (STC) ST01783AT–D, certificated in any category.

**Note 1:** This AD applies to each airplane identified in the preceding applicability provision, regardless of whether it has been otherwise modified, altered, or repaired in the area subject to the requirements of this AD. For airplanes that have been modified, altered, or repaired so that the performance of the requirements of this AD is affected, the owner/operator must request approval for an alternative method of compliance in accordance with paragraph (c) of this AD. The request should include an assessment of the effect of the modification, alteration, or repair on the unsafe condition addressed by this AD; and, if the unsafe condition has not been eliminated, the request should include specific proposed actions to address it.

**Compliance:** Required as indicated, unless accomplished previously.

To ensure that the flight crew is able to remove electrical power from the in-flight entertainment (IFE) system when necessary and is advised of appropriate procedures for such action, accomplish the following:

#### Modification and Airplane Flight Manual Revision

(a) Within 18 months after the effective date of this AD, accomplish paragraphs (a)(1) and (a)(2) of this AD.

(1) Modify the IFE system installed on the airplane by installing two new relays and a new circuit breaker, according to TIMCO Service Bulletin TSB–767–23–009, Revision IR, dated August 22, 2001.

(2) Revise the procedures under “Electrical Smoke or Fire” in the “Emergency Procedures” section of the airplane flight manual (AFM) to include TIMCO AFM Supplement TIM–AFM–01035, dated March 13, 2002. When the information in that AFM supplement has been incorporated into the FAA-approved general revisions of the AFM, the general revisions may be incorporated into the AFM, and the AFM supplement may be removed from the AFM.

#### Part Installation

(b) As of the effective date of this AD, no person may install an IFE system according to STC ST01783AT–D on any airplane, unless the IFE system is modified and the AFM is revised according to this AD.

#### Alternative Methods of Compliance

(c) An alternative method of compliance or adjustment of the compliance time that provides an acceptable level of safety may be

used if approved by the Manager, Atlanta Aircraft Certification Office (ACO), FAA. Operators shall submit their requests through an appropriate FAA Principal Maintenance Inspector, who may add comments and then send it to the Manager, Atlanta ACO.

**Note 2:** Information concerning the existence of approved alternative methods of compliance with this AD, if any, may be obtained from the Atlanta ACO.

#### Special Flight Permits

(d) Special flight permits may be issued in accordance with §§ 21.197 and 21.199 of the Federal Aviation Regulations (14 CFR 21.197 and 21.199) to operate the airplane to a location where the requirements of this AD can be accomplished.

Issued in Renton, Washington, on December 26, 2002.

**Michael Kaszycki,**

*Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.*

[FR Doc. 03–14 Filed 1–2–03; 8:45 am]

**BILLING CODE 4910–13–P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. 2002–NM–19–AD]

RIN 2120–AA64

#### Airworthiness Directives; Boeing Model 727, 737–100, 737–200, and 737–200C Series Airplanes

**AGENCY:** Federal Aviation Administration, (DOT).

**ACTION:** Supplemental notice of proposed rulemaking; reopening of comment period.

**SUMMARY:** This document revises an earlier proposed airworthiness directive (AD), applicable to certain Boeing Model 727, 737–100, 737–200, and 737–200C series airplanes. That proposed AD would have required a one-time inspection to determine the part number of hydraulic accumulators installed in various areas of the airplane, and follow-on corrective actions if necessary. This new action revises the proposed rule by adding an inspection of an additional area of the airplane, and follow-on corrective actions if necessary. This new action also clarifies what actions are necessary for accumulators with certain part numbers. This action is necessary to prevent high-velocity separation of a barrel, piston, or end cap from a hydraulic accumulator. Such separation could result in injury to personnel in the accumulator area; loss of cabin pressurization; loss of affected hydraulic systems; or damage to

plumbing, electrical installations, or structural members. This action is intended to address the identified unsafe condition.

**DATES:** Comments must be received by February 7, 2003.

**ADDRESSES:** Submit comments in triplicate to the Federal Aviation Administration (FAA), Transport Airplane Directorate, ANM–114, Attention: Rules Docket No. 2002–NM–19–AD, 1601 Lind Avenue, SW., Renton, Washington 98055–4056. Comments may be inspected at this location between 9 a.m. and 3 p.m., Monday through Friday, except Federal holidays. Comments may be submitted via fax to (425) 227–1232. Comments may also be sent via the Internet using the following address: [9-anm-nprmcomment@faa.gov](mailto:9-anm-nprmcomment@faa.gov). Comments sent via fax or the Internet must contain “Docket No. 2002–NM–19–AD” in the Internet as attached electronic files must be formatted in Microsoft Word 97 for Windows or ASCII text.

The service information referenced in the proposed rule may be obtained from Boeing Commercial Airplane Group, PO Box 3707, Seattle, Washington 98124–2207. This information may be examined at the FAA, Transport Airplane Directorate, 1601 Lind Avenue, SW., Renton, Washington.

#### FOR FURTHER INFORMATION CONTACT:

Barbara Mudrovich, Aerospace Engineer, Systems and Equipment Branch, ANM–130S, FAA, Seattle Aircraft Certification Office, 1601 Lind Avenue, SW., Renton, Washington 98055–4056; telephone (425) 227–2983; fax (425) 227–1181.

#### SUPPLEMENTARY INFORMATION:

##### Comments Invited

Interested persons are invited to participate in the making of the proposed rule by submitting such written data, views, or arguments as they may desire. Communications shall identify the Rules Docket number and be submitted in triplicate to the address specified above. All communications received on or before the closing date for comments, specified above, will be considered before taking action on the proposed rule. The proposals contained in this action may be changed in light of the comments received.

Submit comments using the following format:

- Organize comments issue-by-issue. For example, discuss a request to change the compliance time and a request to change the service bulletin reference as two separate issues.