

incidental costs, such as the time required to gain access and close up, planning time, or time necessitated by other administrative actions.

Changes to 14 CFR Part 39/Effect on the Proposed AD

On July 10, 2002, the FAA issued a new version of 14 CFR part 39 (67 FR 47997, July 22, 2002), which governs the FAA's airworthiness directives system. The regulation now includes material that relates to altered products, special flight permits, and alternative methods of compliance. Because we have now included this material in part 39, only the office authorized to approve AMOCs is identified in each individual AD.

Regulatory Impact

The regulations proposed herein would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government. Therefore, it is determined that this proposal would not have federalism implications under Executive Order 13132.

For the reasons discussed above, I certify that this proposed regulation (1) is not a "significant regulatory action" under Executive Order 12866; (2) is not a "significant rule" under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979); and (3) if promulgated, will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act. A copy of the draft regulatory evaluation prepared for this action is contained in the Rules Docket. A copy of it may be obtained by contacting the Rules Docket at the location provided under the caption ADDRESSES.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Safety.

The Proposed Amendment

Accordingly, pursuant to the authority delegated to me by the Administrator, the Federal Aviation Administration proposes to amend part 39 of the Federal Aviation Regulations (14 CFR part 39) as follows:

PART 39—AIRWORTHINESS DIRECTIVES

1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

2. Section 39.13 is amended by adding the following new airworthiness directive:

Airbus: Docket 2002–NM–179–AD.

Applicability: All Model A310 series airplanes, certificated in any category.

Compliance: Required as indicated, unless accomplished previously.

To prevent decreased structural integrity of the two half fittings and loss of the ram air turbine (RAT) during extension, which could lead to reduced controllability of the airplane in the event of a dual engine failure, or in the event of loss of two or all hydraulic systems, accomplish the following:

Service Bulletin References

(a) The following information pertains to the service bulletin referenced in this AD:

(1) The term "service bulletin," as used in this AD, means the Accomplishment Instructions of Airbus Service Bulletin A310–57A2084, including Appendix 01, dated May 3, 2002.

(2) Although the service bulletin referenced in this AD specifies to submit information to the manufacturer, this AD does not include such a requirement.

Conductivity Test

(b) Within 600 flight hours after the effective date of this AD, perform a one-time electrical conductivity test of the two half fittings holding the RAT ejection jack, to verify correct heat treatment of the half fittings, per the service bulletin.

(1) If correct heat treatment of the two half fittings is verified, no further action is required by this paragraph.

(2) If incorrect heat treatment of any half fitting is found by the test performed in paragraph (b) of this AD, perform a detailed inspection of the two half fittings for any cracking or corrosion, per the service bulletin.

Note 1: For the purposes of this AD, a detailed inspection is defined as: "An intensive visual examination of a specific structural area, system, installation, or assembly to detect damage, failure, or irregularity. Available lighting is normally supplemented with a direct source of good lighting at intensity deemed appropriate by the inspector. Inspection aids such as mirror, magnifying lenses, etc., may be used. Surface cleaning and elaborate access procedures may be required."

Corrective Action

(c) For any half fittings that require a detailed inspection per paragraph (b)(2) of this AD: Do the actions specified in paragraph (c)(1) or (c)(2) of this AD, as applicable, per the service bulletin.

(1) If no cracking or corrosion is found: Within one year after the effective date of this AD, replace the two half fittings with half fittings having part number A5721023800000 that have successfully passed the electrical conductivity test, per the service bulletin.

(2) If any cracking or corrosion is found: Before further flight, replace the two half fittings with half fittings having part number A5721023800000 that have successfully

passed the electrical conductivity test, per the service bulletin.

Parts Installation

(d) As of the effective date of this AD, no person shall install a half fitting having part number A5721023800000 that has not successfully passed the electrical conductivity test per the service bulletin, on any airplane.

Alternative Methods of Compliance

(e) In accordance with 14 CFR 39.19, the Manager, ANM–116, FAA, is authorized to approve alternative methods of compliance for this AD.

Note 2: The subject of this AD is addressed in French airworthiness directive 2002–263(B), dated May 15, 2002.

Issued in Renton, Washington, on June 12, 2003.

Kalene C. Yanamura,

Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.

[FR Doc. 03–15335 Filed 6–17–03; 8:45 am]

BILLING CODE 4910–13–P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. 2001–NM–238–AD]

RIN 2120–AA64

Airworthiness Directives; Boeing Model 747–100, 747–100B, 747–100B SUD, 747–200B, 747–200F, 747–200C, 747–300, 747SR, and 747SP Series Airplanes

AGENCY: Federal Aviation Administration, DOT.

ACTION: Notice of proposed rulemaking (NPRM).

SUMMARY: This document proposes the adoption of a new airworthiness directive (AD) that is applicable to all Boeing Model 747–100, 747–100B, 747–100B SUD, 747–200B, 747–200F, 747–200C, 747–300, 747SR, and 747SP series airplanes. This proposal would require repetitive inspections for discrepancies of the structure near and common to the upper chord and splice fittings of the rear spar of the wing, and repair if necessary. This proposal also would provide for an optional modification that, if accomplished, would terminate the repetitive inspection requirement, but would necessitate eventual post-modification inspections. This action is necessary to find and fix fatigue cracking of structure near and common to the upper chord and splice fittings of the rear spar of the wing, which could result in loss of structural integrity of