

accumulation of dust in the M03 module.”

The FAA agrees and the Summary is changed in this AD.

### Request To Remove Model 1E From the Applicability

In the second comment, the manufacturer requests that we remove the model 1E from the Applicability statement because this model is no longer in service nor included on the Direction Generale de L'Aviation Civile (DGAC) Type Certificate. The model 1E was also erroneously included in the manufacturer's service bulletin.

The FAA does not agree. The model 1E is still included in the FAA Type Certificate Data Sheet for Arriel 1 engines; therefore, for consistency with the existing documentation, the FAA maintains the model 1E in the Applicability statement.

### Request To Change Regulatory Paragraph (a)(2)

In the third comment, the manufacturer requests that we change paragraph (a)(2) “Modification TU 175 Not Incorporated”. The manufacturer asks that the FAA change “area D as defined in the engine maintenance manual \* \* \*” to “area III as defined in the engine maintenance manual, even if it has not reached 1,000 operating hours, \* \* \*”.

The FAA agrees and paragraph (a)(2) of this AD is changed.

After careful review of the available data, including the comments noted above, the FAA has determined that air safety and the public interest require the adoption of the rule with the changes described previously. The FAA has determined that these changes will neither increase the economic burden on any operator nor increase the scope of the AD.

### Regulatory Analysis

This final rule does not have federalism implications, as defined in Executive Order 13132, because it would not have a substantial direct effect on the States, on the relationship between the national government and the States, or on the distribution of power and responsibilities among the various levels of government. Accordingly, the FAA has not consulted with state authorities prior to publication of this final rule.

For the reasons discussed above, I certify that this action (1) is not a “significant regulatory action” under Executive Order 12866; (2) is not a “significant rule” under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979); and (3)

will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act. A final evaluation has been prepared for this action and it is contained in the Rules Docket. A copy of it may be obtained by contacting the Rules Docket at the location provided under the caption **ADDRESSES**.

### List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Safety.

### Adoption of the Amendment

■ Accordingly, pursuant to the authority delegated to me by the Administrator, the Federal Aviation Administration amends part 39 of the Federal Aviation Regulations (14 CFR part 39) as follows:

### PART 39—AIRWORTHINESS DIRECTIVES

■ 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

#### § 39.13 [Amended]

■ 2. Section 39.13 is amended by adding a new airworthiness directive to read as follows:

**2003-12-14 Turbomeca S.A.: Amendment 39-13199. Docket No. 2002-NE-43-AD.**

**Applicability:** This airworthiness directive (AD) is applicable to Turbomeca S.A. Arriel 1 A, 1 A1, 1 A2, 1 B, 1 C, 1 C1, 1 C2, 1 D, 1 D1, 1 E, 1 E2, 1 K, 1 K1, 1 S, and 1 S1 turboshaft engines. These engines are installed on, but not limited to, Eurocopter AS 350, AS 350B1, AS 350B2, AS 365C, AS 365C2, AS 365N, AS 365N1, AS 365N2, BK 117C1, BK 117C2, Augusta A109 K2, and Sikorsky S76 C helicopters.

**Note 1:** This AD applies to each engine identified in the preceding applicability provision, regardless of whether it has been modified, altered, or repaired in the area subject to the requirements of this AD. For engines that have been modified, altered, or repaired so that the performance of the requirements of this AD is affected, the owner/operator must request approval for an alternative method of compliance in accordance with paragraph (d) of this AD. The request should include an assessment of the effect of the modification, alteration, or repair on the unsafe condition addressed by this AD; and, if the unsafe condition has not been eliminated, the request should include specific proposed actions to address it.

**Compliance:** Compliance with this AD is required as indicated, unless already done.

To prevent an unbalance of the gas generator rotating assembly which may lead to deterioration of the gas generator rear bearing and also to uncommanded engine shutdown, do the following:

### Initial Inspections and Cleaning

(a) For engines that have been operated in a dusty or erosive atmospheric environment containing substances such as laterite, sand, volcanic ash, and chemical particles, and engines for which the operating environment cannot be determined, do the following:

(1) Perform an initial visual inspection for erosion of the axial compressor, within 50 operating hours after the effective date of this AD. Information on inspecting can be found in Turbomeca S.A. Mandatory Service Bulletin (MSB) No. 292 72 0230, dated October 16, 1998.

### Modification TU 175 Not Incorporated

(2) For engines that do not have Modification TU 175 incorporated, if axial compressor erosion is above 1.5 millimeters in area III as defined in the engine maintenance manual, even if it has not reached 1,000 operating hours, and if the module M03 has operated more than 200 hours with this M02 module, clean the M03 module within the next 50 operating hours. Information on cleaning can be found in Turbomeca S.A. MSB No. 292 72 0230, dated October 16, 1998.

### Modification TU 175 Incorporated

(3) For engines that have Modification TU 175 incorporated, if axial compressor erosion inspection requires the M02 module to be removed, and if the M03 module has operated more than 400 hours with this M02 module, clean the M03 module within the next 50 operating hours. Information on cleaning can be found in Turbomeca S.A. MSB No. 292 72 0230, dated October 16, 1998.

### Reconditioning and Checks

(b) Perform reconditioning and checks of the engines. Information on reconditioning and checks can be found in Turbomeca S.A. MSB No. 292 72 0230, dated October 16, 1998.

### Repetitive Inspections

(c) Repeat axial compressor erosion inspections within every 200 operating hours-since-last-inspection (HSLI) for engines that do not have Modification TU 175 incorporated, and within every 400 operating HSLI, for engines that have Modification TU 175 incorporated, as specified in paragraph (a) of this AD.

### Alternative Methods of Compliance

(d) An alternative method of compliance or adjustment of the compliance time that provides an acceptable level of safety may be used if approved by the Manager, Engine Certification Office (ECO). Operators must submit their request through an appropriate FAA Principal Maintenance Inspector, who may add comments and then send it to the Manager, ECO.

**Note 2:** Information concerning the existence of approved alternative methods of compliance with this airworthiness directive, if any, may be obtained from the ECO.

**Note 3:** A list of authorized repair centers qualified to carry out gas generator rotating assembly maintenance and cleaning may be obtained from Turbomeca S.A. or the ECO.