

Actions	Compliance	Procedures
(1) Accomplish the following inspections: (i) Using Impedance-Plane Eddy-Current inspection procedures, inspect the aft dihedral fittings, P/N 111.34.07.469 and P/N 111.34.07.470, for cracks; and (ii) Using Radiographic inspection procedures, inspect the forward dihedral fittings, P/N 111.34.07.471 and P/N 111.34.07.472, for cracks.	At whichever of the following occurs later, unless already accomplished: upon the accumulation of 3,000 hours time-in-service (TIS) on the dihedral fittings or 10 years after installation of the dihedral fittings, whichever occurs first; or within 90 days after the effective date of this AD.	Inspect in accordance with Pilatus PC-7 Service Bulletin No. 57-006, Revision No. 3, dated January 15, 2003.
(2) If a crack is found in any aft dihedral fittings, P/N 111.34.07.469 and/or P/N 111.34.07.470, replace with an improved fitting, P/N 557.10.09.071 and/or P/N 557.10.09.072 (as applicable or FAA-approved equivalent P/N), and modify the spar-cap bolt holes.	Prior to further flight after the inspection required in paragraph (d)(1) of this AD.	Modify in accordance with Pilatus PC-7 Service Bulletin No. 57-006, Revision No. 3, dated January 15, 2003.
(3) If no cracks are found in any aft dihedral fittings, P/N 111.34.07.469 and P/N 111.34.07.470, modify the fittings and the spar-cap bolt holes.	Prior to further flight after the inspection required in paragraph (d)(1) of this AD.	Modify in accordance with Pilatus PC-7 Service Bulletin No. 57-006, Revision No. 3, dated January 15, 2003.
(4) If cracks are found in any forward dihedral fittings, P/N 111.34.07.471 and/or P/N 111.34.07.472, replace with a new part.	Prior to further flight after the inspection required in paragraph (d)(1) of this AD.	Not applicable.
(5) If no cracks are found in any forward dihedral fittings, P/N 111.34.07.471 and P/N 111.34.07.472, no further action is required.	Not applicable.	Not applicable.
(6) Only install aft dihedral fittings that have a P/N of 557.10.09.071 and P/N 557.10.09.072. You must also accomplish the spar-cap bolt hole modification.	As of the effective date of this AD.	Modify the spar-cap bolt holes in accordance with Pilatus PC-7 Service Bulletin No. 57-006, Revision No. 3, dated January 15, 2003.

(e) *Can I comply with this AD in any other way?* To use an alternative method of compliance or adjust the compliance time, follow the procedures in 14 CFR 39.19. Send these requests to the Manager, Standards Office, Small Airplane Directorate. For information on any already approved alternative methods of compliance, contact Doug Rudolph, Aerospace Engineer, FAA, Small Airplane Directorate, 901 Locust, Room 301, Kansas City, Missouri 64106; telephone: (816) 329-4059; facsimile: (816) 329-4090.

(f) *How do I get copies of the documents referenced in this AD?* You may get copies of the documents referenced in this AD from Pilatus Aircraft Ltd., Customer Liaison Manager, CH-6371 Stans, Switzerland; telephone: +41 41 619 63 19; facsimile: +41 41 619 6224; or from Pilatus Business Aircraft Ltd., Product Support Department, 11755 Airport Way, Broomfield, Colorado 80021; telephone: (303) 465-9099; facsimile: (303) 465-6040. You may view these documents at FAA, Central Region, Office of the Regional Counsel, 901 Locust, Room 506, Kansas City, Missouri 64106.

Note: The subject of this AD is addressed in Swiss AD HB 2003-196, dated May 12, 2003.

Issued in Kansas City, Missouri, on June 26, 2003.

Michael Gallagher,
Manager, Small Airplane Directorate, Aircraft Certification Service.

[FR Doc. 03-16844 Filed 7-2-03; 8:45 am]

BILLING CODE 4910-13-P

DEPARTMENT OF HEALTH AND HUMAN SERVICES

Food and Drug Administration

21 CFR Part 131

[Docket No. 00P-0685]

Milk and Cream Products and Yogurt Products; Petition to Revoke Standards for Lowfat Yogurt and Nonfat Yogurt and to Amend Standards for Yogurt and Cultured Milk

AGENCY: Food and Drug Administration, HHS.

ACTION: Advance notice of proposed rulemaking.

SUMMARY: The Food and Drug Administration (FDA) is announcing that a petition has been filed requesting that the agency revoke the standards of identity for lowfat yogurt and nonfat

yogurt; amend the standard of identity for yogurt in numerous respects, including incorporation of provisions for lowfat and nonfat yogurt; and amend the standard of identity for cultured milk in numerous respects, including allowing for the use of the alternate term "fermented milk." We request comment on whether the actions requested by the petition would promote honesty and fair dealing in the interest of consumers.

DATES: Submit written or electronic comments by October 1, 2003.

ADDRESSES: Submit written comments to the Division of Dockets Management (HFA-305), Food and Drug Administration, 5630 Fishers Lane, rm. 1061, Rockville, MD 20852. Submit electronic comments to <http://www.fda.gov/dockets/ecomments>. The petition is available for review at the Division of Dockets Management or electronically on FDA's Web site at <http://www.fda.gov/ohrms/dockets/98fr/00p-0685-cp00001.pdf>. You may also request a copy of the petition from the Division of Dockets Management.

FOR FURTHER INFORMATION CONTACT: Ritu Nalubola, Office of Nutritional Products, Labeling, and Dietary Supplements, Center for Food Safety and Applied Nutrition (HFS-820), Food and Drug