

the effect of the modification, alteration, or repair on the unsafe condition addressed by this AD; and if the unsafe condition has not been eliminated, the request should include specific proposed actions to address it.

Compliance: Required as indicated, unless accomplished previously.

To prevent failure of a tailboom support strut or lug on a cluster fitting, which could cause rotation of a tailboom into the main rotor blades, and subsequent loss of control of the helicopter, accomplish the following:

(a) Within 10 hours time-in-service (TIS), and thereafter at intervals not to exceed 50 hours TIS, for helicopters with cluster fittings, P/N 269A2234 or P/N 269A2235:

(1) Using paint remover, remove paint from the lugs on each cluster fitting. Wash with water and dry. The tailboom support strut must be removed prior to the paint stripping.

(2) Dye-penetrant inspect the lugs on each cluster fitting. See the following Figure 1:

BILLING CODE 4910-13-P

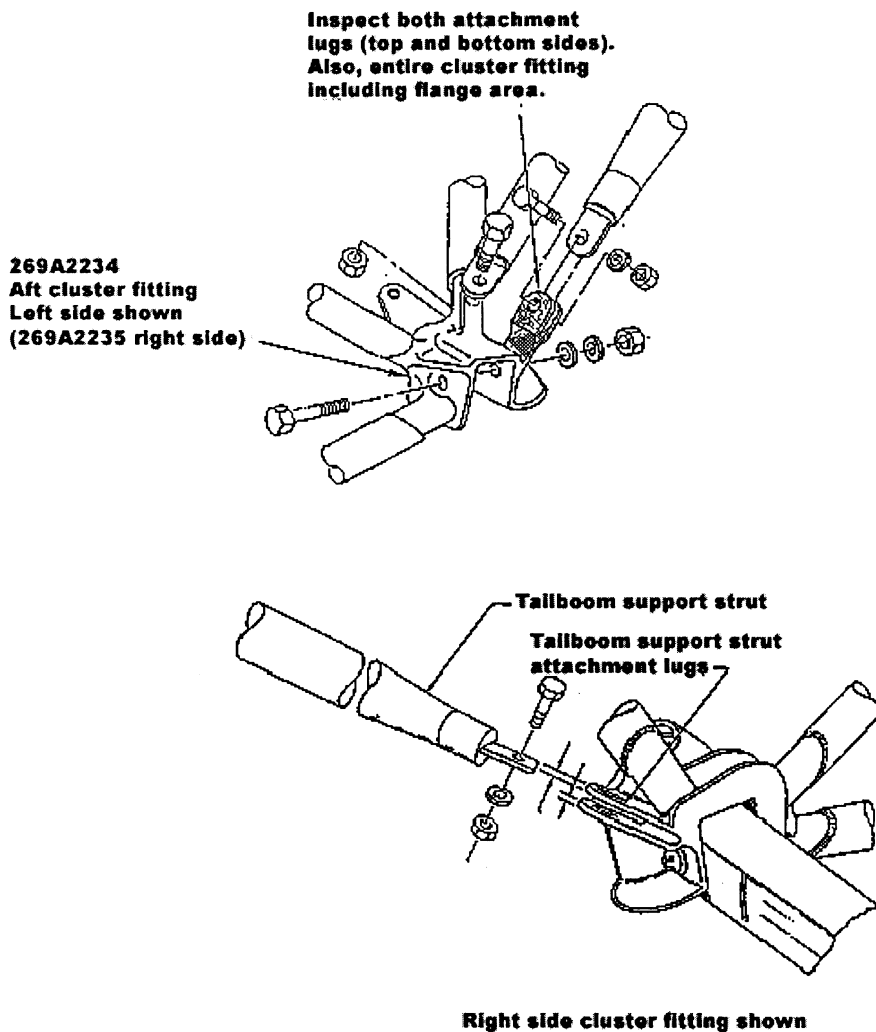


Figure 1

BILLING CODE 4910-13-C

(3) If a crack is found, before further flight, replace the cracked cluster fitting with an airworthy cluster fitting.

(b) Cluster fittings, P/N 269A2234 and P/N 269A2235, that have NOT been modified with Kit P/N SA-269K-106-1, are NOT eligible replacement parts.

(c) Within 150 hours TIS or 6 months, whichever occurs first, replace each cluster

fitting, P/N 269A2234 and P/N 269A2235, with an airworthy cluster fitting or modify each cluster fitting, P/N 269A2234 and P/N 269A2235, with Kit, P/N SA-269K-106-1. Installing the kit is terminating action for the 50-hour TIS repetitive dye-penetrant inspection for these cluster fittings. Broken or cracked cluster fittings are not eligible for the kit modification.

(d) For helicopters with strut assemblies, P/N 269A2015 or 269A2015-5, accomplish the following:

(1) At intervals not to exceed 50 hours TIS:

(i) Remove the strut assemblies, P/N 269A2015 or P/N 269A2015-5.

(ii) Visually inspect the strut aluminum end fittings for deformation or damage and dye-penetrant inspect the strut aluminum end fittings for a crack in accordance with