

Administration proposes to amend part 39 of the Federal Aviation Regulations (14 CFR part 39) as follows:

PART 39—AIRWORTHINESS DIRECTIVES

1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

2. Section 39.13 is amended by adding the following new airworthiness directive:

Boeing: Docket 2002–NM–207–AD.

Applicability: Model 747–100, –100B, –100B SUD, –200B, –200C, –200F, –300, 747SR, and 747SP series airplanes; equipped with Pratt & Whitney JT9D series engines; line numbers 1 through 669 inclusive; certificated in any category.

Compliance: Required as indicated, unless accomplished previously.

To prevent improper connection of the cowl latch located in the left-hand side of the cowl panel assembly of each engine, which could result in separation of a cowl panel from the airplane, accomplish the following:

Drill Holes

(a) Within 36 months after the effective date of this AD: Drill witness holes through the cowl skin at each of the six cowl latch locations located on the left-hand side of the cowl panel assembly of each engine, per paragraphs 3.B.1. through 3.B.4. of the Accomplishment Instructions of Boeing Service Bulletin 747–71–2301, dated May 30, 2002.

Alternative Methods of Compliance

(b) In accordance with 14 CFR 39.19, the Manager, Seattle Aircraft Certification Office, FAA, is authorized to approve alternative methods of compliance for this AD.

Issued in Renton, Washington, on July 1, 2003.

Vi L. Lipski,

Manager, Transport Airplane Directorate, Aircraft Certification Service.

[FR Doc. 03–17318 Filed 7–8–03; 8:45 am]

BILLING CODE 4910–13–P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. 2003–NM–143–AD]

RIN 2120–AA64

Airworthiness Directives; Bombardier Model CL–600–2B19 (Regional Jet Series 100 & 440) Airplanes

AGENCY: Federal Aviation Administration, DOT.

ACTION: Notice of proposed rulemaking (NPRM).

SUMMARY: This document proposes the adoption of a new airworthiness directive (AD) that is applicable to certain Model CL–600–2B19 (Regional Jet Series 100 & 440) airplanes. This proposal would require revising the airworthiness limitations section of the Instructions for Continued Airworthiness by incorporating new structural inspection intervals for the vertical beams of the pressure bulkheads at fuselage stations 409+128 and 559; repairing the vertical beams if necessary; and submitting inspection findings to the airplane manufacturer. This action is necessary to detect and correct, in a timely manner, fatigue cracks in the vertical beams of the pressure bulkheads at fuselage stations 409+128 and 559, which could result in the reduced structural integrity of the airplane. This action is intended to address the identified unsafe condition.

DATES: Comments must be received by August 8, 2003.

ADDRESSES: Submit comments in triplicate to the Federal Aviation Administration (FAA), Transport Airplane Directorate, ANM–114, Attention: Rules Docket No. 2003–NM–143–AD, 1601 Lind Avenue, SW., Renton, Washington 98055–4056. Comments may be inspected at this location between 9 a.m. and 3 p.m., Monday through Friday, except Federal holidays. Comments may be submitted via fax to (425) 227–1232. Comments may also be sent via the Internet using the following address: 9-anm-nprmcomment@faa.gov. Comments sent via fax or the Internet must contain “Docket No. 2003–NM–143–AD” in the subject line and need not be submitted in triplicate. Comments sent via the Internet as attached electronic files must be formatted in Microsoft Word 97 or 2000 or ASCII text.

The service information referenced in the proposed rule may be obtained from Bombardier, Inc., Canadair, Aerospace Group, P.O. Box 6087, Station Centre-ville, Montreal, Quebec H3C 3G9, Canada. This information may be examined at the FAA, Transport Airplane Directorate, 1601 Lind Avenue, SW., Renton, Washington; or at the FAA, New York Aircraft Certification Office, 10 Fifth Street, Third Floor, Valley Stream, New York.

FOR FURTHER INFORMATION CONTACT: Serge Napoleon, Aerospace Engineer, Airframe and Propulsion Branch, ANE–171, FAA, New York Aircraft Certification Office, 10 Fifth Street, Third Floor, Valley Stream, New York 11581; telephone (516) 256–7512; fax (516) 568–2716.

SUPPLEMENTARY INFORMATION:

Comments Invited

Interested persons are invited to participate in the making of the proposed rule by submitting such written data, views, or arguments as they may desire. Communications shall identify the Rules Docket number and be submitted in triplicate to the address specified above. All communications received on or before the closing date for comments, specified above, will be considered before taking action on the proposed rule. The proposals contained in this action may be changed in light of the comments received.

Submit comments using the following format:

- Organize comments issue-by-issue. For example, discuss a request to change the compliance time and a request to change the service bulletin reference as two separate issues.
- For each issue, state what specific change to the proposed AD is being requested.
- Include justification (e.g., reasons or data) for each request.

Comments are specifically invited on the overall regulatory, economic, environmental, and energy aspects of the proposed rule. All comments submitted will be available, both before and after the closing date for comments, in the Rules Docket for examination by interested persons. A report summarizing each FAA-public contact concerned with the substance of this proposal will be filed in the Rules Docket.

Commenters wishing the FAA to acknowledge receipt of their comments submitted in response to this action must submit a self-addressed, stamped postcard on which the following statement is made: “Comments to Docket Number 2003–NM–143–AD.” The postcard will be date stamped and returned to the commenter.

Availability of NPRMs

Any person may obtain a copy of this NPRM by submitting a request to the FAA, Transport Airplane Directorate, ANM–114, Attention: Rules Docket No. 2003–NM–143–AD, 1601 Lind Avenue, SW., Renton, Washington 98055–4056.

Discussion

Transport Canada Civil Aviation (TCCA), which is the airworthiness authority for Canada, notified the FAA that an unsafe condition may exist on certain Bombardier Model CL–600–2B19 (Regional Jet series 100 & 440) airplanes. TCCA advises that fatigue cracks were found in the vertical beams of the pressure bulkheads at fuselage stations 409+128 and 559. This