

§ 39.13 [Amended]

2. Section 39.13 is amended by adding the following new airworthiness directive:

McDonnell Douglas: Docket 2001–NM–57–AD.

Applicability: Model MD–11 airplanes, as listed in Boeing Alert Service Bulletin MD11–24A041, Revision 03, dated September 11, 2002; certificated in any category.

Note 1: This AD applies to each airplane identified in the preceding applicability provision, regardless of whether it has been modified, altered, or repaired in the area subject to the requirements of this AD. For airplanes that have been modified, altered, or repaired so that the performance of the requirements of this AD is affected, the owner/operator must request approval for an alternative method of compliance in accordance with paragraph (d)(1) of this AD. The request should include an assessment of the effect of the modification, alteration, or repair on the unsafe condition addressed by this AD; and, if the unsafe condition has not been eliminated, the request should include specific proposed actions to address it.

Compliance: Required as indicated, unless accomplished previously.

To prevent the wire bundle contained in the feed-through from contacting the bottom of the feed-through, which could cause cable chafing, electrical arcing, and smoke or fire in the cockpit, accomplish the following:

Inspection

(a) Within 1 year after the effective date of this AD, do a one-time detailed inspection of the wire bundle installation behind the first observer's station to detect damaged or chafed wires per Boeing Alert Service Bulletin MD11–24A041, Revision 03, dated September 11, 2002.

Note 2: For the purposes of this AD, a detailed inspection is defined as: "An intensive visual examination of a specific structural area, system, installation, or assembly to detect damage, failure, or irregularity. Available lighting is normally supplemented with a direct source of good lighting at intensity deemed appropriate by the inspector. Inspection aids such as mirror, magnifying lenses, etc., may be used. Surface cleaning and elaborate access procedures may be required."

Condition 1: No Damaged or Chafed Wire

(b) If no damaged or chafed wire is detected during the detailed inspection required by paragraph (a) of this AD, before further flight, revise the wire bundle support clamp installation per Boeing Alert Service Bulletin MD11–24A041, Revision 03, dated September 11, 2002.

Condition 2: Any Damaged or Chafed Wire

(c) If any damaged or chafed wire is detected during the detailed inspection required by paragraph (a) of this AD, before further flight, repair wiring, and revise the wire bundle support clamp installation, per Boeing Alert Service Bulletin MD11–24A041, Revision 03, dated September 11, 2002.

Alternative Methods of Compliance

(d)(1) An alternative method of compliance or adjustment of the compliance time that provides an acceptable level of safety may be used if approved by the Manager, Los Angeles Aircraft Certification Office (ACO), FAA. Operators shall submit their requests through an appropriate FAA Principal Maintenance Inspector, who may add comments and then send it to the Manager, Los Angeles ACO.

Note 3: Information concerning the existence of approved alternative methods of compliance with this AD, if any, may be obtained from the Los Angeles ACO.

(2) Alternative methods of compliance, approved previously in accordance with AD 2000–03–13, amendment 39–11572, are approved as alternative methods of compliance with this AD.

Special Flight Permits

(e) Special flight permits may be issued in accordance with sections 21.197 and 21.199 of the Federal Aviation Regulations (14 CFR 21.197 and 21.199) to operate the airplane to a location where the requirements of this AD can be accomplished.

Issued in Renton, Washington, on July 17, 2003.

Ali Bahrami,

Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.

[FR Doc. 03–18789 Filed 7–23–03; 8:45 am]

BILLING CODE 4910–13–P

DEPARTMENT OF TRANSPORTATION**Federal Aviation Administration****14 CFR Part 39**

[Docket No. 2001–NM–278–AD]

RIN 2120–AA64

Airworthiness Directives; Boeing Model 747–200C and –200F Series Airplanes

AGENCY: Federal Aviation Administration, DOT.

ACTION: Notice of proposed rulemaking (NPRM).

SUMMARY: This document proposes the adoption of a new airworthiness directive (AD) that is applicable to certain Boeing Model 747–200C and –200F series airplanes. This proposal would require repetitive inspections to find fatigue cracking in the upper chord of the upper deck floor beams, and repair if necessary. For certain airplanes, this proposal would also provide for an optional repair/modification, which would extend certain repetitive inspection intervals. This action is necessary to find and fix cracking in certain upper deck floor beams. Such cracking could extend and

sever floor beams adjacent to the body frame and could result in rapid decompression and consequent loss of controllability of the airplane. This action is intended to address the identified unsafe condition.

DATES: Comments must be received by September 8, 2003.

ADDRESSES: Submit comments in triplicate to the Federal Aviation Administration (FAA), Transport Airplane Directorate, ANM–114, Attention: Rules Docket No. 2001–NM–278–AD, 1601 Lind Avenue, SW., Renton, Washington 98055–4056. Comments may be inspected at this location between 9 a.m. and 3 p.m., Monday through Friday, except Federal holidays. Comments may be submitted via fax to (425) 227–1232. Comments may also be sent via the Internet using the following address: *9-anm-nprmcomment@faa.gov*. Comments sent via fax or the Internet must contain "Docket No. 2001–NM–278–AD" in the subject line and need not be submitted in triplicate. Comments sent via the Internet as attached electronic files must be formatted in Microsoft Word 97 or 2000 or ASCII text.

The service information referenced in the proposed rule may be obtained from Boeing Commercial Airplane Group, PO Box 3707, Seattle, Washington 98124–2207. This information may be examined at the FAA, Transport Airplane Directorate, 1601 Lind Avenue, SW., Renton, Washington.

FOR FURTHER INFORMATION CONTACT: Rick Kawaguchi, Aerospace Engineer, Airframe Branch, ANM–120S, FAA, Transport Airplane Directorate, Seattle Aircraft Certification Office, 1601 Lind Avenue, SW., Renton, Washington 98055–4056; telephone (425) 917–6434; fax (425) 917–6590.

SUPPLEMENTARY INFORMATION:**Comments Invited**

Interested persons are invited to participate in the making of the proposed rule by submitting such written data, views, or arguments as they may desire. Communications shall identify the Rules Docket number and be submitted in triplicate to the address specified above. All communications received on or before the closing date for comments, specified above, will be considered before taking action on the proposed rule. The proposals contained in this action may be changed in light of the comments received.

Submit comments using the following format:

- Organize comments issue-by-issue. For example, discuss a request to change the compliance time and a