

amends part 39 of the Federal Aviation Regulations (14 CFR part 39) as follows:

PART 39—AIRWORTHINESS DIRECTIVES

■ 1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

■ 2. Section 39.13 is amended by adding the following new airworthiness directive:

2003-15-04 BAE Systems (Operations) Limited (Formerly British Aerospace Regional Aircraft): Amendment 39-13246. Docket 2002-NM-62-AD.

Applicability: All Model Jetstream 4101 airplanes, certificated in any category.

Note 1: This AD applies to each airplane identified in the preceding applicability provision, regardless of whether it has been modified, altered, or repaired in the area subject to the requirements of this AD. For airplanes that have been modified, altered, or repaired so that the performance of the requirements of this AD is affected, the owner/operator must request approval for an alternative method of compliance in accordance with paragraph (b) of this AD. The request should include an assessment of the effect of the modification, alteration, or repair on the unsafe condition addressed by this AD; and, if the unsafe condition has not been eliminated, the request should include specific proposed actions to address it.

Compliance: Required as indicated, unless accomplished previously.

To prevent failure of the main landing gear (MLG) and consequent reduced controllability of the airplane during takeoff or landing, accomplish the following:

Inspection, and Replacement if Necessary

(a) Within 60 days after the effective date of this AD, perform a general visual inspection of the drive trunnion pins for the MLG doors to determine the part number (P/N) of the pins, per "Part 1—Inspection" of the Accomplishment Instructions of BAE Systems (Operations) Limited Service Bulletin J41-32-080, dated January 24, 2002.

Note 2: For the purposes of this AD, a general visual inspection is defined as: "A visual examination of an interior or exterior area, installation, or assembly to detect obvious damage, failure, or irregularity. This level of inspection is made from within touching distance unless otherwise specified. A mirror may be necessary to enhance visual access to all exposed surfaces in the inspection area. This level of inspection is made under normally available lighting conditions such as daylight, hangar lighting, flashlight, or droplight and may require removal or opening of access panels or doors. Stands, ladders, or platforms may be required to gain proximity to the area being checked."

(1) If P/N AIR135154 is found on both pins: No further action is required by this paragraph.

(2) If any pin having P/N AIR134402 is found, or if any pin having no P/N is found:

Within 90 days after accomplishing the inspection, replace the pin having P/N AIR134402 or the pin having no P/N, with a new, improved pin, per "Part 2—Rectification" of the Accomplishment Instructions of the service bulletin.

Alternative Methods of Compliance

(b) An alternative method of compliance or adjustment of the compliance time that provides an acceptable level of safety may be used if approved by the Manager, International Branch, ANM-116, Transport Airplane Directorate, FAA. Operators shall submit their requests through an appropriate FAA Principal Maintenance Inspector, who may add comments and then send it to the Manager, International Branch, ANM-116.

Note 3: Information concerning the existence of approved alternative methods of compliance with this AD, if any, may be obtained from the International Branch, ANM-116.

Special Flight Permits

(c) Special flight permits may be issued in accordance with sections 21.197 and 21.199 of the Federal Aviation Regulations (14 CFR 21.197 and 21.199) to operate the airplane to a location where the requirements of this AD can be accomplished.

Incorporation by Reference

(d) The actions shall be done in accordance with BAE Systems (Operations) Limited Service Bulletin J41-32-080, dated January 24, 2002. This incorporation by reference was approved by the Director of the Federal Register in accordance with 5 U.S.C. 552(a) and 1 CFR part 51. Copies may be obtained from British Aerospace Regional Aircraft American Support, 13850 Mclearen Road, Herndon, Virginia 20171. Copies may be inspected at the FAA, Transport Airplane Directorate, 1601 Lind Avenue, SW., Renton, Washington; or at the Office of the Federal Register, 800 North Capitol Street, NW., Suite 700, Washington, DC.

Note 4: The subject of this AD is addressed in British airworthiness directive 007-01-2002.

Effective Date

(e) This amendment becomes effective on September 2, 2003.

Issued in Renton, Washington, on July 18, 2003.

Ali Bahrami,

Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.

[FR Doc. 03-18790 Filed 7-25-03; 8:45 am]

BILLING CODE 4910-13-P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. 2002-NM-34-AD; Amendment 39-13245; AD 2003-15-03]

RIN 2120-AA64

Airworthiness Directives; Boeing Model 767-200, -300, and -300F Series Airplanes

AGENCY: Federal Aviation Administration, DOT.

ACTION: Final rule.

SUMMARY: This amendment adopts a new airworthiness directive (AD), applicable to certain Boeing Model 767 series airplanes, that requires replacement of the aileron control override quadrant with a modified unit. The actions specified by this AD are intended to prevent corrosion of the input override mechanism bearings of the lateral central control actuator, which, in the event of a subsequent jam in the pilot's aileron control system, could result in failure of the aileron override system and consequent reduced lateral controllability of the airplane. This action is intended to address the identified unsafe condition.

DATES: Effective September 2, 2003.

The incorporation by reference of certain publications listed in the regulations is approved by the Director of the Federal Register as of September 2, 2003.

ADDRESSES: The service information referenced in this AD may be obtained from Boeing Commercial Airplane Group, P.O. Box 3707, Seattle, Washington 98124-2207. This information may be examined at the Federal Aviation Administration (FAA), Transport Airplane Directorate, Rules Docket, 1601 Lind Avenue, SW., Renton, Washington; or at the Office of the Federal Register, 800 North Capitol Street, NW., Suite 700, Washington, DC.

FOR FURTHER INFORMATION CONTACT:

Douglas Tsuji, Aerospace Engineer, Systems and Equipment Branch, ANM-130S, FAA, Seattle Aircraft Certification Office, 1601 Lind Avenue, SW., Renton, Washington 98055-4056; telephone (425) 917-6487; fax (425) 917-6590.

SUPPLEMENTARY INFORMATION: A proposal to amend part 39 of the Federal Aviation Regulations (14 CFR part 39) to include an airworthiness directive (AD) that is applicable to certain Boeing Model 767 series airplanes was published as a supplemental notice of proposed rulemaking (NPRM) in the **Federal Register** on February 24, 2003