

area, installation, or assembly to detect obvious damage, failure, or irregularity. This level of inspection is made from within touching distance unless otherwise specified. A mirror may be necessary to enhance visual access to all exposed surfaces in the inspection area. This level of inspection is made under normally available lighting conditions such as daylight, hangar lighting, flashlight, or droplight and may require removal or opening of access panels or doors. Stands, ladders, or platforms may be required to gain proximity to the area being checked."

Inspection To Determine Weight, Tie Rod Replacement, and Placard Installation

(d) For airplanes in the groups listed in the table under paragraph 3., Part 1, paragraph F., of the Accomplishment Instructions of Boeing Service Bulletin 777-25-0144, Revision 1, dated January 10, 2002: Do the actions in paragraphs (d)(1), (d)(2), and (d)(3) of this AD.

(1) Within 5 years after the effective date of this AD, replace the vertical support tie rods for electrical racks E9, E11, and E13 (including replacing the existing tie rods with new improved tie rods, replacing an existing tie rod clamp with a new improved tie rod clamp, performing a free-play inspection of certain electrical racks, adjusting jam nuts as applicable, performing a general visual inspection through the witness hole to make sure tie rod threads are visible, and making any applicable adjustment to ensure tie rod threads are visible) by doing all actions specified in Figures 5, 6, 7, and 9 of the service bulletin; as applicable. Do these actions per the Accomplishment Instructions of the service bulletin. Any required adjustment must be done before further flight.

(2) Before further flight after accomplishing paragraph (d)(1) of this AD, install placards that show weight limits for electrical racks E9, E11, and E13; as applicable; per the Accomplishment Instructions of the service bulletin.

(3) For each electrical rack on which a placard was installed per paragraph (d)(2) of this AD: Before further flight after accomplishing paragraphs (d)(1) and (d)(2) of this AD, perform a one-time inspection and records check to determine the weight of equipment installed in that electrical rack. This records review and inspection must include determining what, if any, extra equipment has been installed in the subject racks of the airplane, performing a detailed inspection to determine that this equipment is installed on the airplane, calculating the total weight of the installed equipment, and comparing that total to the weight limit specified on the placard installed per paragraph (d)(2) of this AD. If the weight is outside the limits specified in the placard, before further flight, remove equipment from the rack to meet the weight limit specified in the placard.

Exception to Service Bulletin Instructions

(e) Where the service bulletin specifies to contact Boeing for appropriate action, before further flight, repair per a method approved by the Manager, Seattle Aircraft Certification Office (ACO), FAA; or per data meeting the

type certification basis of the airplane approved by a Boeing Company Designated Engineering Representative who has been authorized by the Manager, Seattle ACO, to make such findings. For a repair method to be approved, the approval must specifically reference this AD.

Alternative Methods of Compliance

(f) In accordance with 14 CFR 39.19, the Manager, Seattle ACO, is authorized to approve alternative methods of compliance for this AD.

Issued in Renton, Washington, on September 2, 2003.

Kalene C. Yanamura,

Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.

[FR Doc. 03-22890 Filed 9-8-03; 8:45 am]

BILLING CODE 4910-13-P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. 2002-NM-97-AD]

RIN 2120-AA64

Airworthiness Directives; Airbus Model A300 B4-600R and A300 F4-600R Series Airplanes

AGENCY: Federal Aviation Administration, DOT.

ACTION: Notice of proposed rulemaking (NPRM).

SUMMARY: This document proposes the superseding of an existing airworthiness directive (AD), applicable to certain Airbus Model A300 B4-600R and A300 F4-600R series airplanes, that currently requires a one-time visual inspection for damage of the center tank fuel pumps and fuel pump canisters, and replacement of damaged fuel pumps and fuel pump canisters with new or serviceable parts. That AD also requires repetitive visual inspections of the fuel pumps and repetitive eddy current inspections of the fuel pump canisters, and replacement of damaged fuel pumps and fuel pump canisters with new or serviceable parts. This action would mandate modification of the canisters of the center tank fuel pumps, which would terminate the repetitive inspections required by the existing AD. The actions specified by the proposed AD are intended to prevent damage to the fuel pump and fuel pump canister, which could result in loss of flame trap capability and could provide a fuel ignition source in the center fuel tank. This action is intended to address the identified unsafe condition.

DATES: Comments must be received by October 9, 2003.

ADDRESSES: Submit comments in triplicate to the Federal Aviation Administration (FAA), Transport Airplane Directorate, ANM-114, Attention: Rules Docket No. 2002-NM-97-AD, 1601 Lind Avenue, SW., Renton, Washington 98055-4056. Comments may be inspected at this location between 9 a.m. and 3 p.m., Monday through Friday, except Federal holidays. Comments may be submitted via fax to (425) 227-1232. Comments may also be sent via the Internet using the following address: 9-anm-nprmcomment@faa.gov. Comments sent via fax or the Internet must contain "Docket No. 2002-NM-97-AD" in the subject line and need not be submitted in triplicate. Comments sent via the Internet as attached electronic files must be formatted in Microsoft Word 97 or 2000 or ASCII text.

The service information referenced in the proposed rule may be obtained from Airbus Industrie, 1 Rond Point Maurice Bellonte, 31707 Blagnac Cedex, France. This information may be examined at the FAA, Transport Airplane Directorate, 1601 Lind Avenue, SW., Renton, Washington.

FOR FURTHER INFORMATION CONTACT: Tim Backman, Aerospace Engineer, International Branch, ANM-116, FAA, Transport Airplane Directorate, 1601 Lind Avenue, SW., Renton, Washington 98055-4056; telephone (425) 227-2797; fax (425) 227-1149.

SUPPLEMENTARY INFORMATION:

Comments Invited

Interested persons are invited to participate in the making of the proposed rule by submitting such written data, views, or arguments as they may desire. Communications shall identify the Rules Docket number and be submitted in triplicate to the address specified above. All communications received on or before the closing date for comments, specified above, will be considered before taking action on the proposed rule. The proposals contained in this action may be changed in light of the comments received.

Submit comments using the following format:

- Organize comments issue-by-issue. For example, discuss a request to change the compliance time and a request to change the service bulletin reference as two separate issues.
- For each issue, state what specific change to the proposed AD is being requested.
- Include justification (e.g., reasons or data) for each request.