

DEPARTMENT OF TRANSPORTATION**Federal Aviation Administration****14 CFR Part 39**

[Docket No. 2002–NM–226–AD]

RIN 2120–AA64

Airworthiness Directives; Dornier Model 328–100 Series Airplanes

AGENCY: Federal Aviation Administration, DOT.

ACTION: Notice of proposed rulemaking (NPRM).

SUMMARY: This document proposes the adoption of a new airworthiness directive (AD) that is applicable to certain Dornier Model 328–100 series airplanes. This proposal would require a one-time inspection of certain engine control cables to determine the batch number on the end fitting, and replacement of affected cables with new cables. This action is necessary to prevent failure of defective engine control cables, which could result in loss of the engine controls, and consequent reduced controllability of the airplane. This action is intended to address the identified unsafe condition.

DATES: Comments must be received by January 5, 2004.

ADDRESSES: Submit comments in triplicate to the Federal Aviation Administration (FAA), Transport Airplane Directorate, ANM–114, Attention: Rules Docket No. 2002–NM–226–AD, 1601 Lind Avenue, SW., Renton, Washington 98055–4056. Comments may be inspected at this location between 9 a.m. and 3 p.m., Monday through Friday, except Federal holidays. Comments may be submitted via fax to (425) 227–1232. Comments may also be sent via the Internet using the following address: *9-anm-nprmcomment@faa.gov*. Comments sent via fax or the Internet must contain “Docket No. 2002–NM–226–AD” in the subject line and need not be submitted in triplicate. Comments sent via the Internet as attached electronic files must be formatted in Microsoft Word 97 or 2000 or ASCII text.

The service information referenced in the proposed rule may be obtained from AvCraft Aerospace GmbH, P.O. Box 1103, D–82230 Wessling, Germany. This information may be examined at the FAA, Transport Airplane Directorate, 1601 Lind Avenue, SW., Renton, Washington.

FOR FURTHER INFORMATION CONTACT: Dan Rodina, Aerospace Engineer, International Branch, ANM–116, FAA,

Transport Airplane Directorate, 1601 Lind Avenue, SW., Renton, Washington 98055–4056; telephone (425) 227–2125; fax (425) 227–1149.

SUPPLEMENTARY INFORMATION:**Comments Invited**

Interested persons are invited to participate in the making of the proposed rule by submitting such written data, views, or arguments as they may desire. Communications shall identify the Rules Docket number and be submitted in triplicate to the address specified above. All communications received on or before the closing date for comments, specified above, will be considered before taking action on the proposed rule. The proposals contained in this action may be changed in light of the comments received.

Submit comments using the following format:

- Organize comments issue-by-issue. For example, discuss a request to change the compliance time and a request to change the service bulletin reference as two separate issues.
- For each issue, state what specific change to the proposed AD is being requested.
- Include justification (*e.g.*, reasons or data) for each request.

Comments are specifically invited on the overall regulatory, economic, environmental, and energy aspects of the proposed rule. All comments submitted will be available, both before and after the closing date for comments, in the Rules Docket for examination by interested persons. A report summarizing each FAA-public contact concerned with the substance of this proposal will be filed in the Rules Docket.

Commenters wishing the FAA to acknowledge receipt of their comments submitted in response to this action must submit a self-addressed, stamped postcard on which the following statement is made: “Comments to Docket Number 2002–NM–226–AD.” The postcard will be date stamped and returned to the commenter.

Availability of NPRMs

Any person may obtain a copy of this NPRM by submitting a request to the FAA, Transport Airplane Directorate, ANM–114, Attention: Rules Docket No. 2002–NM–226–AD, 1601 Lind Avenue, SW., Renton, Washington 98055–4056.

Discussion

The Luftfahrt-Bundesamt (LBA), which is the airworthiness authority for Germany, notified the FAA that an unsafe condition may exist on certain Dornier Model 328–100 series airplanes.

The LBA advises that, during testing, the manufacturer of the engine control cables, SARMA, found evidence of cracking on the end fittings of two specific batches of parts, due to a manufacturing problem. Such cracking, if not corrected, could result in failure of the engine control cables, subsequent loss of the engine controls, and consequent reduced controllability of the airplane.

Explanation of Relevant Service Information

Dornier has issued Service Bulletin SB–328–76–409, Revision 1, dated May 17, 2002, which describes procedures for inspecting engine control cables having part number 001A761A1130–016 to determine the manufacturing batch number, and replacing affected engine control cables with new cables. Accomplishment of the actions specified in the service bulletin is intended to adequately address the identified unsafe condition. The LBA classified this service bulletin as mandatory and issued German airworthiness directive 2002–252, dated September 5, 2002, to ensure the continued airworthiness of these airplanes in Germany.

FAA’s Conclusions

This airplane model is manufactured in Germany and is type certificated for operation in the United States under the provisions of § 21.29 of the Federal Aviation Regulations (14 CFR 21.29) and the applicable bilateral airworthiness agreement. Pursuant to this bilateral airworthiness agreement, the LBA has kept the FAA informed of the situation described above. The FAA has examined the findings of the LBA, reviewed all available information, and determined that AD action is necessary for products of this type design that are certificated for operation in the United States.

Explanation of Requirements of Proposed AD

Since an unsafe condition has been identified that is likely to exist or develop on other airplanes of the same type design registered in the United States, the proposed AD would require accomplishment of the actions specified in the service bulletin described previously, except as discussed below.

Differences Between the Service Bulletin and Proposed AD

Although the service bulletin specifies to send any engine control cable removed from the airplane to the parts manufacturer, this proposed AD does not require that action.