

Parts Installation

(d) As of the effective date of this AD: No person may install an Arkwin Industries RAT actuator having P/N 764711 on any Airbus Model A319, A320, or A321 airplane, unless it is in compliance with this AD.

Note 1: The subject of this AD is addressed in French airworthiness directive 2001-236(B) R1, dated December 24, 2002.

Issued in Renton, Washington, on December 5, 2003.

Kalene C. Yanamura,

Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.

[FR Doc. 03-31065 Filed 12-16-03; 8:45 am]

BILLING CODE 4910-13-P

DEPARTMENT OF TRANSPORTATION**Federal Aviation Administration****14 CFR Part 39**

[Docket No. 2002-NM-18-AD]

RIN 2120-AA64

Airworthiness Directives; Airbus Model A319, A320, and A321 Series Airplanes

AGENCY: Federal Aviation Administration, DOT.

ACTION: Notice of proposed rulemaking (NPRM).

SUMMARY: This document proposes the adoption of a new airworthiness directive (AD) that is applicable to certain Airbus Model A319, A320, and A321 series airplanes. This proposal would require replacing the upper guide rod fittings at the rear passenger doors with improved fittings. This action is necessary to prevent failure of an upper guide rod fitting, which could cause a rear passenger door to jam during opening, delaying an emergency evacuation and resulting in injury to passengers or crew members. This action is intended to address the identified unsafe condition.

DATES: Comments must be received by January 16, 2004.

ADDRESSES: Submit comments in triplicate to the Federal Aviation Administration (FAA), Transport Airplane Directorate, ANM-114, Attention: Rules Docket No. 2002-NM-18-AD, 1601 Lind Avenue, SW., Renton, Washington 98055-4056. Comments may be inspected at this location between 9 a.m. and 3 p.m., Monday through Friday, except Federal holidays. Comments may be submitted via fax to (425) 227-1232. Comments may also be sent via the Internet using the following address: 9-anm-nprmcomment@faa.gov. Comments sent via fax or the Internet must contain

“Docket No. 2002-NM-18-AD” in the subject line and need not be submitted in triplicate. Comments sent via the Internet as attached electronic files must be formatted in Microsoft Word 97 or 2000 or ASCII text.

The service information referenced in the proposed rule may be obtained from Airbus, 1 Rond Point Maurice Bellonte, 31707 Blagnac Cedex, France. This information may be examined at the FAA, Transport Airplane Directorate, 1601 Lind Avenue, SW., Renton, Washington.

FOR FURTHER INFORMATION CONTACT: Dan Rodina, Aerospace Engineer, International Branch, ANM-116, FAA, Transport Airplane Directorate, 1601 Lind Avenue, SW., Renton, Washington 98055-4056; telephone (425) 227-2125; fax (425) 227-1149.

SUPPLEMENTARY INFORMATION:**Comments Invited**

Interested persons are invited to participate in the making of the proposed rule by submitting such written data, views, or arguments as they may desire. Communications shall identify the Rules Docket number and be submitted in triplicate to the address specified above. All communications received on or before the closing date for comments, specified above, will be considered before taking action on the proposed rule. The proposals contained in this action may be changed in light of the comments received.

Submit comments using the following format:

- Organize comments issue-by-issue. For example, discuss a request to change the compliance time and a request to change the service bulletin reference as two separate issues.
- For each issue, state what specific change to the proposed AD is being requested.
- Include justification (*e.g.*, reasons or data) for each request.

Comments are specifically invited on the overall regulatory, economic, environmental, and energy aspects of the proposed rule. All comments submitted will be available, both before and after the closing date for comments, in the Rules Docket for examination by interested persons. A report summarizing each FAA-public contact concerned with the substance of this proposal will be filed in the Rules Docket.

Commenters wishing the FAA to acknowledge receipt of their comments submitted in response to this action must submit a self-addressed, stamped postcard on which the following statement is made: “Comments to

Docket Number 2002-NM-18-AD.” The postcard will be date stamped and returned to the commenter.

Availability of NPRMs

Any person may obtain a copy of this NPRM by submitting a request to the FAA, Transport Airplane Directorate, ANM-114, Attention: Rules Docket No. 2002-NM-18-AD, 1601 Lind Avenue, SW., Renton, Washington 98055-4056.

Discussion

The Direction Générale de l'Aviation Civile (DGAC), which is the airworthiness authority for France, notified the FAA that an unsafe condition may exist on certain Airbus Model A319, A320, and A321 series airplanes. The DGAC advises that there have been several reports of cracking and rupture of the upper guide rod fittings for the rear passenger doors on in-service airplanes. This condition, if not corrected, could cause a rear passenger door to jam during opening, delaying an emergency evacuation and resulting in injury to passengers or crew members.

Explanation of Relevant Service Information

Airbus has issued Service Bulletin A320-53-1154, Revision 2, dated March 7, 2003. That service bulletin describes procedures for replacing the upper guide rod fitting on each rear passenger door with an improved fitting. The improved fitting is stronger than the existing one due to an increase in thickness and different material.

Accomplishment of the actions specified in the service bulletin is intended to adequately address the identified unsafe condition. The DGAC classified a previous revision of this service bulletin as mandatory and issued French airworthiness directive 2001-634(B), dated December 26, 2001, to ensure the continued airworthiness of these airplanes in France.

FAA's Conclusions

These airplane models are manufactured in France and are type certificated for operation in the United States under the provisions of section 21.29 of the Federal Aviation Regulations (14 CFR 21.29) and the applicable bilateral airworthiness agreement. Pursuant to this bilateral airworthiness agreement, the DGAC has kept the FAA informed of the situation described above. The FAA has examined the findings of the DGAC, reviewed all available information, and determined that AD action is necessary for products of this type design that are