

Administration proposes to amend part 39 of the Federal Aviation Regulations (14 CFR part 39) as follows:

PART 39—AIRWORTHINESS DIRECTIVES

1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

2. Section 39.13 is amended by adding a new airworthiness directive to read as follows:

Eurocopter France: Docket No. 2002–SW–49–AD.

Applicability: Model SA–365N, N1, AS–365N2, N3, SA–366 G1, AS355F, F1, F2, N and EC130 B4 helicopters, with TRW–SMM main servocontrols, part number SC8031, SC8031A, SC8031–1, SC8031–2, SC8032–1, SC8032–2, SC8033–1, SC8033–2, SC8034–1, SC8034–2, SC8042 or SC8043, overhauled or repaired at Hawker Pacific Aerospace before March 1, 2002, installed, certificated in any category.

Note 1: This AD applies to each helicopter identified in the preceding applicability provision, regardless of whether it has been otherwise modified, altered, or repaired in the area subject to the requirements of this AD. For helicopters that have been modified, altered, or repaired so that the performance of the requirements of this AD is affected, the owner/operator must request approval for an

alternative method of compliance in accordance with paragraph (b) of this AD. The request should include an assessment of the effect of the modification, alteration, or repair on the unsafe condition addressed by this AD; and if the unsafe condition has not been eliminated, the request should include specific proposed actions to address it.

Compliance: Required as indicated, unless accomplished previously.

To prevent thread failure, separation of the upper end-fitting that attaches the servocontrol cylinder to the upper ball end-fitting, and subsequent loss of control of the helicopter, accomplish the following:

(a) Replace each servocontrol with a servocontrol that does not fall within the “Applicability” of this AD in accordance with the following table:

For servocontrols that have been in service for:	Replace the servocontrols:
(1) Less than 1,000 hours time-in-service (TIS)	Within the next 550 hours TIS or 12 months, whichever occurs first.
(2) 1,000 or more hours TIS, and less than 1,300 hours TIS	Before the servocontrols reach 1,550 hours TIS or within 9 months, whichever occurs first.
(3) 1,300 or more hours TIS	Within the next 250 hours TIS or 6 months, whichever occurs first.

Note 2: Eurocopter Alert Telex No. 67.00.08 for Model AS 365 N, N1, N2, and N3 helicopters; Alert Telex No. 67.03 for Model AS 366 G1 helicopters; Alert Telex No. 67.00.23 for Model AS 355 F, F1, F2, and N helicopters; and Alert Telex No. 67A001 for Model EC 130 B4 helicopters, all dated April 29, 2002, pertain to the subject of this AD.

(b) An alternative method of compliance or adjustment of the compliance time that provides an acceptable level of safety may be used if approved by the Manager, Regulations Group, Rotorcraft Directorate, FAA. Operators shall submit their requests through an FAA Principal Maintenance Inspector, who may concur or comment and then send it to the Manager, Regulations Group.

Note 3: Information concerning the existence of approved alternative methods of compliance with this AD, if any, may be obtained from the Regulations Group.

(c) Special flight permits may be issued in accordance with 14 CFR 21.197 and 21.199 to operate the helicopter to a location where the requirements of this AD can be accomplished.

Note 4: The subject of this AD is addressed in Direction De L’Aviation Civile (France) AD No’s. 2002–312–056(A), 2002–313–027(A), 2002–315–069(A), and 2002–316–004(A), all dated June 12, 2002.

Issued in Fort Worth, Texas, on January 30, 2003.

David A. Downey,

Manager, Rotorcraft Directorate, Aircraft Certification Service.

[FR Doc. 03–3774 Filed 2–13–03; 8:45 am]

BILLING CODE 4910–13–P

DEPARTMENT OF THE TREASURY

Internal Revenue Service

26 CFR Part 1

[REG–150313–01]

RIN 1545–BA80

Redemptions Taxable as Dividends

AGENCY: Internal Revenue Service (IRS), Treasury.

ACTION: Cancellation of notice of public hearing on proposed rulemaking.

SUMMARY: This document provides notice of cancellation of a public hearing on proposed regulations that provide guidance regarding the treatment of the basis of redeemed stock when a distribution in redemption of such stock is treated as a dividend, as well as guidance regarding certain acquisitions of stock by related corporations that are stock under sections 302, 304, 704, 861, 1371, 1374, and 1502 of the Internal Revenue Code.

DATES: The public hearing originally scheduled for Thursday, February 20, 2003, at 10 a.m., is cancelled.

FOR FURTHER INFORMATION CONTACT: Treena Garrett of the Regulations Unit, Associate Chief Counsel (Procedure and Administration) (202) 622–7180 (not a toll-free number).

SUPPLEMENTARY INFORMATION: A notice of proposed rulemaking and notice of public hearing that appeared in the **Federal Register** on Friday, October 18, 2002, (67 FR 64331), announced that a public hearing was scheduled for Thursday, February 20, 2003, at 10 a.m.

in room 4718, Internal Revenue Service Building, 1111 Constitution Avenue, NW., Washington, DC. The subject of the public hearing is proposed regulations under sections 302, 304, 704, 861, 1371, 1374, and 1502 of the Internal Revenue Code. The public comment period for these proposed regulations expired on Thursday, January 16, 2003. Outlines of oral comments were due on Thursday, January 30, 2003.

The notice of proposed rulemaking and notice of public hearing, instructed those interested in testifying at the public hearing to submit a request to speak and an outline of the topics to be addressed. As of Thursday, February 6, 2003, no one has requested to speak. Therefore, the public hearing scheduled for Thursday, February 20, 2003, is cancelled.

Cynthia E. Grigsby,

Chief, Regulations Unit, Associate Chief Counsel, (Procedure and Administration).

[FR Doc. 03–3751 Filed 2–13–03; 8:45 am]

BILLING CODE 4830–01–P