

Labor cost	Parts cost	Total cost per airplane
6 workhours × \$60 per hour = \$360	\$469	\$360 + \$469 = \$829

Regulatory Impact

Does this AD impact various entities? The regulations adopted herein will not have a substantial direct effect on the States, on the relationship between the national government and the States, or on the distribution of power and responsibilities among the various levels of government. Therefore, it is determined that this final rule does not have federalism implications under Executive Order 13132.

Does this AD involve a significant rule or regulatory action? For the reasons discussed above, I certify that this action (1) is not a "significant regulatory action" under Executive Order 12866; (2) is not a "significant rule" under DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979); and (3) will not have a significant economic impact, positive or negative, on a substantial number of small entities

under the criteria of the Regulatory Flexibility Act. A copy of the final evaluation prepared for this action is contained in the Rules Docket. A copy of it may be obtained by contacting the Rules Docket at the location provided under the caption **ADDRESSES**.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

Adoption of the Amendment

Accordingly, under the authority delegated to me by the Administrator, the Federal Aviation Administration amends part 39 of the Federal Aviation Regulations (14 CFR part 39) as follows:

PART 39—AIRWORTHINESS DIRECTIVES

1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

2. FAA amends § 39.13 by adding a new AD to read as follows:

2003-04-03 SOCATA—Groupe Aerospatiale:
Amendment 39-13051; Docket No. 2002-CE-43-AD.

(a) *What airplanes are affected by this AD?* This AD affects Models TB 9, TB 10, TB 20, TB 21, and TB 200 airplanes, all serial numbers, that are certificated in any category.

(b) *Who must comply with this AD?* Anyone who wishes to operate any of the airplanes identified in paragraph (a) of this AD must comply with this AD.

(c) *What problem does this AD address?* The actions specified by this AD are intended to prevent failure of the aileron control gimbal joint. Such failure could lead to loss of control of the airplane.

(d) *What actions must I accomplish to address this problem?* To address this problem, you must accomplish the following:

Actions	Compliance	Procedures
(1) Inspect the aileron control gimbal joint for correct alignment and correct operation.	Upon accumulating 300 hours time-in-service (TIS) on the aileron control gimbal joint or within the next 30 hours TIS after April 7, 2003 (the effective date of this AD), whichever occurs later. Repetitively inspect thereafter at intervals not to exceed 100 hours TIS.	In accordance with the Accomplishment Instructions in Socata TB Aircraft Mandatory Service Bulletin SB 10-130 27, dated April 2002.
(2) Replace misaligned or defective gimbal joints found during any inspection required in paragraph (d)(1) of this AD.	Prior to further flight after the inspection where a misaligned or defective gimbal joint was found. The inspection requirements of paragraph (d)(1) start over after each replacement.	In accordance with the Accomplishment Instructions in Socata TB Aircraft Mandatory Service Bulletin SB 10-130 27, dated April 2002, and the applicable maintenance manual.

(e) *Can I comply with this AD in any other way?* You may use an alternative method of compliance or adjust the compliance time if:

- (1) Your alternative method of compliance provides an equivalent level of safety; and
- (2) The Manager, Standards Office, Small Airplane Directorate, approves your alternative. Submit your request through an FAA Principal Maintenance Inspector, who may add comments and then send it to the Manager, Standards Office.

Note 1: This AD applies to each airplane identified in paragraph (a) of this AD, regardless of whether it has been modified, altered, or repaired in the area subject to the requirements of this AD. For airplanes that have been modified, altered, or repaired so that the performance of the requirements of this AD is affected, the owner/operator must request approval for an alternative method of compliance in accordance with paragraph (e) of this AD. The request should include an assessment of the effect of the modification, alteration, or repair on the unsafe condition

addressed by this AD; and, if you have not eliminated the unsafe condition, specific actions you propose to address it.

(f) *Where can I get information about any already-approved alternative methods of compliance?* Contact Karl Schletzbaum, Aerospace Engineer, FAA, Small Airplane Directorate, 901 Locust, Room 301, Kansas City, Missouri 64106; telephone: (816) 329-4146; facsimile: (816) 329-4090.

(g) *What if I need to fly the airplane to another location to comply with this AD?* The FAA can issue a special flight permit under sections 21.197 and 21.199 of the Federal Aviation Regulations (14 CFR 21.197 and 21.199) to operate your airplane to a location where you can accomplish the requirements of this AD.

(h) *Are any service bulletins incorporated into this AD by reference?* Actions required by this AD must be done in accordance with Socata TB Aircraft Mandatory Service Bulletin SB 10-130 27, dated April 2002. The Director of the Federal Register approved this

incorporation by reference under 5 U.S.C. 552(a) and 1 CFR part 51. You may get copies from SOCATA Groupe AEROSPATIALE, Customer Support, Aerodrome Tarbes-Ossun-Lourdes, BP 930—F65009 Tarbes Cedex, France; telephone: 011 33 5 62 41 73 00; facsimile: 011 33 5 62 41 76 54; or the Product Support Manager, SOCATA Groupe AEROSPATIALE, North Perry Airport, 7501 Pembroke Road, Pembroke Pines, Florida 33023; telephone: (954) 893-1400; facsimile: (954) 964-4141. You may view copies at the FAA, Central Region, Office of the Regional Counsel, 901 Locust, Room 506, Kansas City, Missouri, or at the Office of the Federal Register, 800 North Capitol Street, NW., suite 700, Washington, DC.

Note 2: The subject of this AD is addressed in French AD 2002-225(A), dated May 15, 2002.

(i) *When does this amendment become effective?* This amendment becomes effective on April 7, 2003.