Actions	Compliance	Procedures
(ii) Mark out Figure 201 of Chapter 27–30–04 of the Model 1900D Airliner Maintenance Manual (125–590000–15). Insert corrected figure (Figure 1 of this AD)		
(2) Incorporate the applicable temporary revision into the maintenance manuals as follows: (i) Temporary Revision No. 27–5 to the Model 1900/1900C Airliner Maintenance Manual: Revised ELEVATOR TRIM OPERATIONAL CHECK; or (ii) Temporary Revision No. 27–9 to the Model 1900D Airliner Maintenance Manual: Added MANUAL ELEVATOR TRIM OPERATIONAL CHECK.	Before the next time you have maintenance done on the elevator trim system.	As specified in Raytheon Safety Communiqué No. 234, dated September 2003.
(3) Do the elevator trim operational check that is specified in the applicable maintenance manual and temporary revisions to the maintenance manual as referenced in paragraph (e)(2) of this AD	Prior to further flight after each time you have maintenance done on the elevator trim system.	As specified in Raytheon Safety Communiqué No. 234, dated September 2003: and Temporary Revision No. 27–5 to the Model 1900/1900C Airliner Maintenance Manual: Revised ELEVATOR TRIM OPERATIONAL CHECK; or Temporary Revision No. 27–9 to the Model 1900D Airliner Maintenance Manual: Added MANUAL ELEVATOR TRIM OPERATIONAL CHECK, both dated September 12, 2003, as applicable.

BILLING CODE 4910–13–P

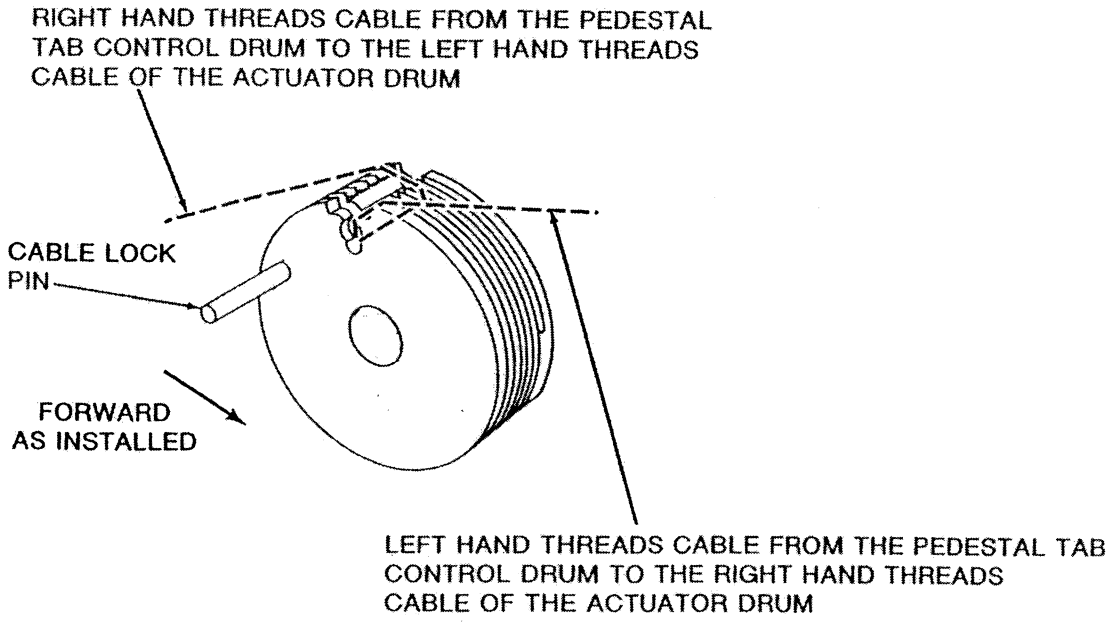

Figure 1